
Installation Instructions

System Overview

These instructions review how to install Verge suspended fixtures. Verge 4ft and 8ft modules can be installed as individual standalone units, or they can be joined together to create continuous runs. The graphic below shows the components required to install a typical run of Verge suspended fixtures.


IMPORTANT: Read all instructions including fixture wiring AND mechanical details before beginning installation.

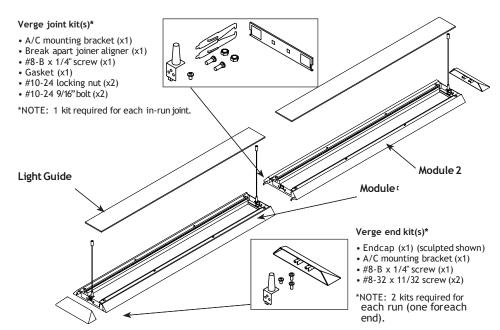

TOOLS REQUIRED: Phillips screwdriver, 3/8 nut driver and flat or#2 Robertson screwdriver.

Module Lengths

Verge suspended systems come in 4ft and 8ft modules. Overall module lengths are shown below. Module lengths do not include endcaps.

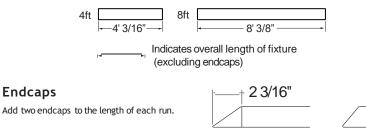

ATTENTION: Install in accordance with national and local building and electrical codes.


Standalone or continuous run configurations



by (s)ignify

Mount Spacing

For on-grid T-bar ceiling installations, mounts attach directly to Tee. For non-accessible ceilings and off-grid T-bar installations, the graphic below indicates mount spacing for typical row lengths. Mounting options are also available for a wide variety of other ceiling types. See Suspended Mounting Options document for more detailed information.

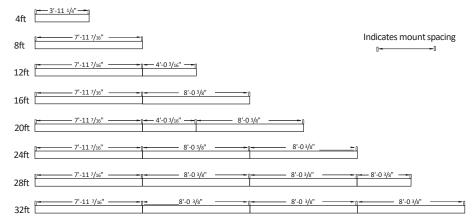

Row Configurations

The tables below indicate how 4ft and 8ft modules can be combined to create continuous rows of various lengths.

8ft

module

7x

7x

8x

8x

9x

9x

10x

10x

11x

11x

12x

12x

Revision D

Nominal row length	4ft module	8ft module		Nominal row length	4ft module
4'	1x]	56"	
8'		1x		6''0	1x
12'	1x	1x		6"4	
16"		2x		6"8	1x
20'	1x	2x		72'	
24'		3x]	76"	1x
28'	1x	3x		80'	
32'		4x		84'	1x
36"	1x	4x	1	88'	
40'		5x]	92'	1x
44'	1x	5x		96"	
48'		6'x		100'	1x
			-		

*Overall row lengths provided do not include endcaps. Add two endcaps to the overall length of each row.

Page 1

©2019 Signify Holding. All rights are reserved. Reproduction in whole or part is prohibited without the written consent of the copyright owner. Phone: 604.888.6811 Web: ledalite.com/products November 17, 2023

Installation Instructions

Suspended LED ID_7606_Verge_Suspended_LED LEDALITE by (s)ignify

Prepare Fixtures /Install ceiling mounting components

Verge

Arrange boxed fixtures on floor in specified mounting locations; remove fixtures from boxes. Install all ceiling mounting components and vertical aircraft cables using separate installation instructions for Aircraft Cable Mounting (supplied).

NOTE: If conditions are dusty/dirty, recommended practice is to leave fixtures in their plastic bags. Cut small holes in the bag as needed to complete the following installation sequence, and then completely remove the bag from the fixture when conditions are clean. This prevents dust and dirt build-up on the fixtures.

Complete Electrical

NON-POWER LOCATIONS: Cap all wires and tuck into

knockout(s). Insert power cord and apply strain relief below

the socket saddle to secure cord. Remove installed quick-

wire connectors (if applicable) at power feed locations and

complete electrical connections using wire nuts (supplied by

POWER LOCATIONS: Remove required 1/2" round

NOTE: Use smallest appropriate wire nuts.

Connections

wirenuts (supplied by others)


others). Tuck wires into wire cavity.

1/2" bushing

1/2"

knockout strain relief


wire cavity.

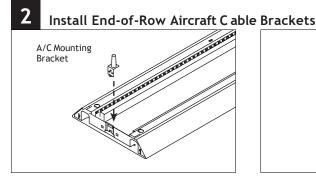

A. Hook A/C mounting bracket to endplate as shown. Raise bracket until security tab is engaged.


B. Attach bracket to fixture using supplied fastener.

NOTE: When installing individual modules, and the first fixture of a row, complete step 2 on both ends of fixture.

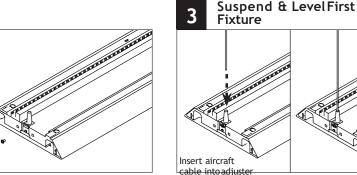

With 2 people, raise the first fixture to the ceiling. At each end of the module, insert aircraft cable through aircraft cable adjuster (located on A/C mount bracket). The adjuster will automatically grip and hold the cable. IMPORTANT: Do not force cable into adjuster. See instruction A (next page) for details. Trim aircraft cable below adjuster as per instruction A (next page).

Level the fixture (see instruction B & C on next page).

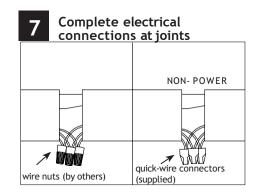


Complete in-row electrical connections.

NON-POWER LOCATIONS: Use supplied quick-wire connectors. Tuck wires into wire cavity.


POWER LOCATIONS: Remove installed quick-wire connectors and complete electrical connections using wire nuts (supplied by others). Tuck wires into wiring cavity.

NOTE 2: Power feed connections can also be completed at joint locations.

ATTENTION: Install in accordance with national and local building and electrical codes.

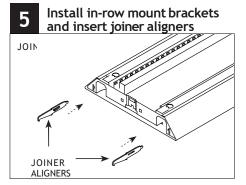

For each additional fixture in the row, at the end furthest from the existing suspended fixture, attach A/C mounting bracket to fixture using supplied fasteners (see step 2). At the end closest to the existing suspended fixture, insert joiner aligners into crossplate (aligners will lock into place).

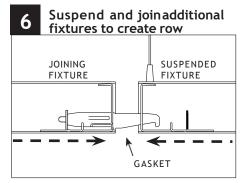

With two people, raise second fixture to ceiling.

At joint, insert joiner aligners through black gasket and into suspended fixture. At other end (opposite joint), insert aircraft cable through adjuster.

IMPORTANT: Do not attempt to join fixtures on floor. Instead, hang one fixture at a time and join modules at ceiling level.





Verge


ID_7606_Verge_Suspended_LED

LEDALITE by (s)ignify

Secure Joints 0 0


SLIDE MODULES TOGETHER: Secure joint from above using supplied nut and bolt hardware.

Repeat STEPS 5-8 for each additional fixture in row.

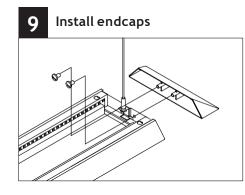

Attach end caps using supplied #8 screws.

IMPORTANT: Do not over-tighten endcap fasteners. Philips Ledalite recommends tightening fasteners by hand. When screwhead is flush with crossplate, turn an additional full turn.

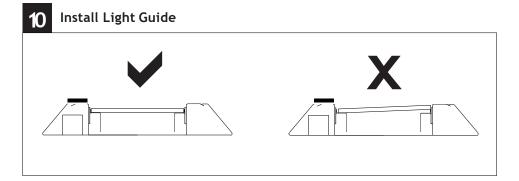

Identify smooth side of the Light Guide and ensure it is installed smooth side DOWN. Install Light Guide panel into LED fixture after joining and wiring is complete. Ensure panel is seated correctly as shown above.

Aircraft cable adjustment

IMPORTANT: Do not force cable into adjuster. To insert cable into adjuster, follow the steps below.

1. CUT

If required, cut cable ends cleanly prior to inserting into adjuster. Recommended cutters: K.K. Porter cable cutter cat. No. 06"90TN or Klein all purpose shears cat. No. 1104.

2. INSERT


Carefully insert cable into tapered end. If cable does not insert easily or becomes jammed during insertion, use the release tool to remove cable. Trim end and repeat process. DO NOT BEND CABLE BELOW BOTTOM OF ADJUSTER.

3. TEST


Once cable is inserted, apply a 25lb point load to each mount bracket to ensure all connections are secure.

NOTE: Ensure fixture is level end-to-end. Support fixture from below and use supplied aircraft cable release tool to make fine height adjustments.

Level horizontally

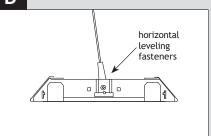

LEVEL HORIZONTALLY (shown above): Loosen fasteners on bottom of adjuster and level as required. Tighten fastener once fixture is in level position.

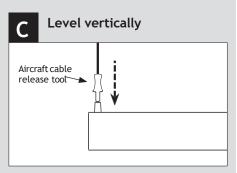

LEVEL VERTICALLY (shown above): Support fixture from below and use supplied aircraft cable release tool to make fine height adjustments (see instruction A for details).

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interreference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

