


READ AND UNDERSTAND THESE INSTRUCTIONS BEFORE INSTALLING LUMINAIRE  
This luminaire is intended for installation in accordance with the National Electrical Code and local regulations.  
To assure full compliance with local codes and regulations, check with your local electrical inspector before installation. To prevent electric shock, turn off electricity at fuse box before proceeding.  
Retain these instructions for maintenance reference.

**CAUTION: (RISK OF FIRE)** DO NOT INSTALL INSULATION WITHIN 3 INCHES (76mm) OF FIXTURE SIDES OR WIRING COMPARTMENT, NOR ABOVE FIXTURE IN SUCH A MANNER SO AS TO ENTRAP HEAT.

**CAUTION:** USE ONLY ROUGH-IN SECTIONS PROVIDED BY LIGHTOLIER. USE OF OTHER MANUFACTURERS' ROUGH-IN KITS WILL VOID THE UNDERWRITERS LABORATORIES LISTING AND COULD CONSTITUTE A FIRE HAZARD.

#### INSTRUCTIONS FOR TYPICAL GRID-TYPE CEILING INSTALLATION

STEP-BY-STEP INSTRUCTIONS ARE GIVEN BELOW FOR THE MOST COMMON TYPE OF CEILING CONSTRUCTION FOR WHICH THE SLOPED CEILING ADAPTOR KIT IS DESIGNED. PLEASE CONSULT LIGHTOLIER FOR INSTALLATION TIPS WITH OTHER TYPES OF CEILINGS.

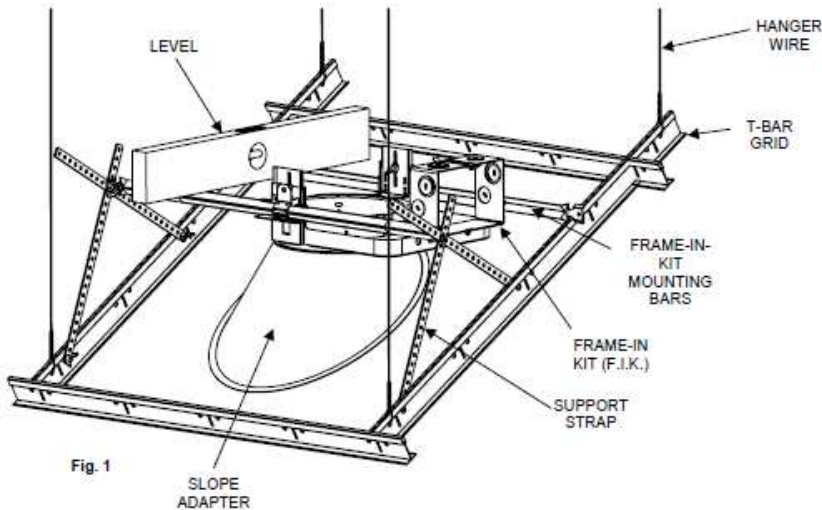

CONSULT INSTRUCTION SHEET SUPPLIED WITH FIK FOR WIRING INFORMATION AND OTHER INSTALLATION DETAILS.

1. INSTALL CEILING GRID. T-BARS, ETC. MUST BE SECURELY ATTACHED TO STRUCTURAL SUPPORTS ABOVE CEILING SURFACE. THIS MAY BE ACCOMPLISHED THROUGH THE USE OF COMMON HANGER WIRE (16 Ga., MIN) ATTACHED TO A MINIMUM OF FOUR PLACES, AS SHOWN.
2. ATTACH SLOPE ADAPTOR TO FRAME RING USING HARDWARE SUPPLIED.
3. PLACE FIK ONTO GRID IN THE APPROXIMATE CORRECT LOCATION. FIK MOUNTING BARS TOWARDS THE REAR (SHALLOW SIDE OF ANGLE) SHOULD REST DIRECTLY ON ANGLED T-BAR. USE HANGER WIRE TO SECURE THESE MOUNTING BARS DIRECTLY TO THE T-BAR. USING HARDWARE SUPPLIED, ATTACH SUPPORT STRAPS TO THE T-BAR AS SHOWN IN FIG.1. ONE STRAP SHOULD BE PLACED ROUGHLY IN LINE WITH THE CENTER OF THE FIK, AND THE OTHER ONE SHOULD BE AT ROUGHLY A 90 DEGREE ANGLE TO THE FIRST. REPEAT THIS ON BOTH SIDES.
4. USING A LEVEL ACROSS BOTH MOUNTING BARS AS SHOWN, ATTACH SUPPORT STRAPS TO FRONT MOUNTING BARS USING HOLE LOCATIONS THAT RESULT IN A LEVEL INSTALLATION.
5. ADJUST HEIGHT OF FIK RING IN SUCH A WAY AS TO ALLOW THE FLANGE OF THE SLOPE ADAPTER TO BE FLUSH WITH THE SURFACE OF THE FINISHED CEILING.
6. REMOVE SLOPE ADAPTER TO FINISH CEILING AS REQUIRED.
7. RE-INSTALL SLOPE ADAPTER AFTER CEILING IS COMPLETED, AND MAKE ANY NECESSARY FINAL ADJUSTMENTS.

